
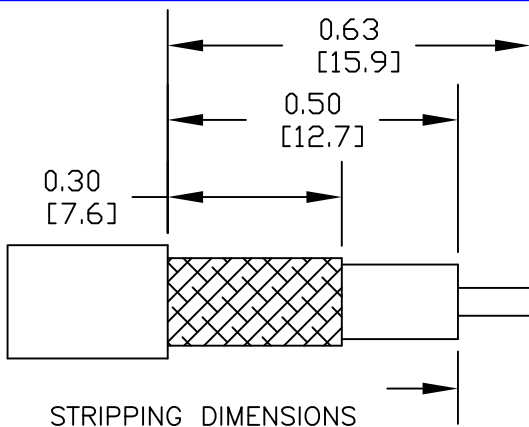


MATERIALS

BODY	BRASS NICKEL PLATED
CONTACT	GOLD PLATED
INSULATOR	PTFE

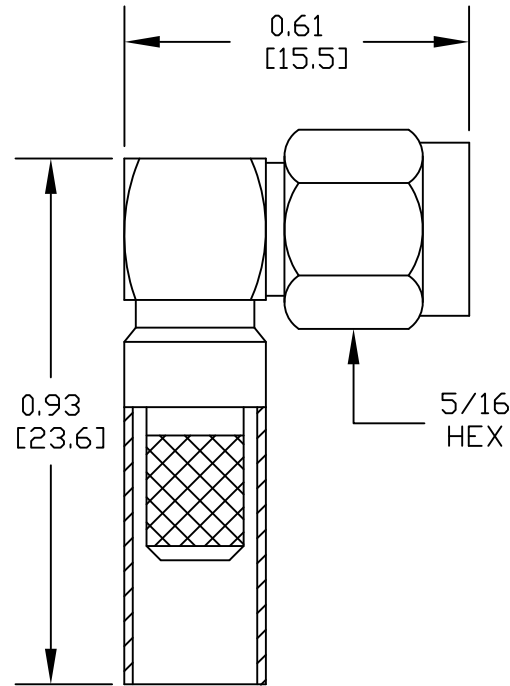

ASSEMBLY PROCEDURES

1. STRIP CABLE AS SHOWN
2. INSTALL CABLE INTO BODY OF CONNECTOR AND SOFT SOLDER CENTER CONDUCTOR IN PLACE
3. CRIMP FERRULE & PRESS CAP DOWN

CRIMP SIZE REQUIRED

0.13 [3.2] FERRULE: .213" HEX CRIMP TOOL



PASTERNAK ENTERPRISES, INC.

P.O BOX 16759, IRVINE, CA 92623
PHONE (949) 261-1920 FAX (949) 261-7451

WEB ADDRESS: www.pasternack.com
E-MAIL ADDRESS: sales@pasternack.com

COAXIAL & FIBER OPTICS

DWG TITLE

PE4783

DES.

REVERSE POLARITY SMA MALE, RIGHT ANGLE, CRIMP ATTACHMENT FOR RG58

REV. A

FSCM NO. 53919

CAD FILE 092011

SCALE N/A

SIZE A

2231

NOTES:

1. UNLESS OTHERWISE SPECIFIED ALL DIMENSIONS ARE NOMINAL.
2. ALL SPECIFICATIONS ARE SUBJECT TO CHANGE WITHOUT NOTICE AT ANY TIME.
3. DIMENSIONS ARE IN INCHES [mm].
4. FITS MIL-C-17 AND EQUIVALENT CABLES.