

DOUBLE-BALANCED MIXERS

M1-0208

Features

- LO/RF 2.0 to 8.0 GHz
- IF DC to 2.0 GHz
- 6.0 dB Typical Conversion Loss
- 35 dB Typical LO to RF Isolation
- Ultra-Broadband LO and RF



Electrical Specifications - Specifications guaranteed from -55 to +100°C, measured in a 50-Ohm system.

Parameter	LO (GHz)	RF (GHz)	IF (GHz)	Min	Тур	Max	Diode Option LO drive level (dBm)
Conversion Loss (dB)	2.0-8.0	2.0-8.0	DC-1.0		6.0	7.6	
	2.0-8.0	2.0-8.0	1.0-2.0		6.5	8.5	
Isolation (dB)							
LO-RF	2.0-8.0	2.0-8.0		25	See		
LO-IF	2.0-8.0	2.0-8.0			Plots		
RF-IF	2.0-8.0	2.0-8.0					
Input 1 dB Compression (dBm)	2.0-8.0	2.0-8.0			+2		L (+7 to +10)
					+5		M (+10 to +13)
					+8		N (+13 to +16)
					+11		H (+16 to +19)
					+14		S (+19 to +22)
Input Two-Tone Third Order	2.0-8.0	2.0-8.0			+12		L (+7 to +10)
Intercept Point (dBm)					+15		M (+10 to +13)
					+18		N (+13 to +16)
					+21		H (+16 to +19)
					+24		S (+19 to +22)

Part Number Options

Please specify diode level and package style by adding to model number.										
Package Styles		Examples								
Connectorized	<u>A</u>	M1-0208LA, M1-0208LE-2								
Microstrip 1,2	<u>E</u>	<u>M1-0208</u>	<u>L</u>	<u>E</u>	<u>-2</u>					
Surface Mount 1,2	<u>EZ</u>	(Model)	(Diode Option)	(Package)	(I-Port Configuration)					

Marki Microwave reserves the right to make changes to the product(s) or information contained herein without notice. Marki Microwave makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Marki Microwave assume any liability whatsoever arising out of the use of or application of any product.

215 Vineyard Court, Morgan Hill, CA 95037 | Ph: 408.778.4200 | Fax 408.778.4300 | info@markimicrowave.com

¹Connectorized test fixtures available for most microstrip and surface mount packages. Consult factory.

²For non-connectorized packages, specify I-port configuration by adding –1 or –2 suffix to model number. Default is –2 configuration when not specified.




DOUBLE-BALANCED MIXERS


M1-0208

Page 2

LO/RF 2.0 to 8.0 GHz IF DC to 2.0 GHz

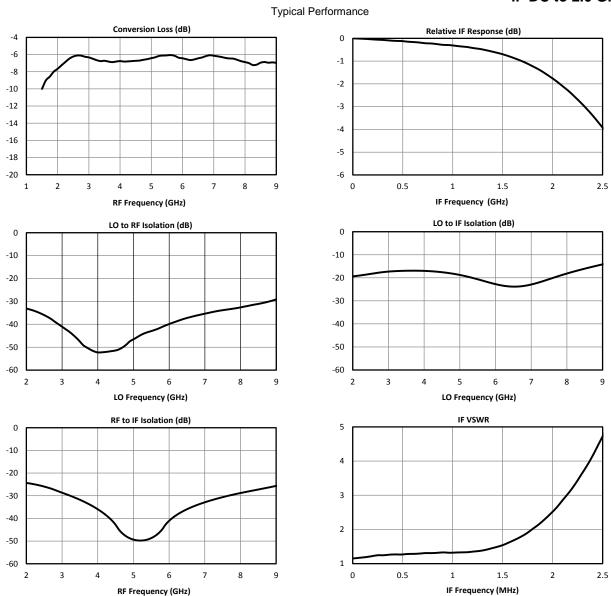

Marki Microwave reserves the right to make changes to the product(s) or information contained herein without notice. Marki Microwave makes no warranty, representation, or guarantee regarding the suitability of its products for any particular purpose, nor does Marki Microwave assume any liability whatsoever arising out of the use or application of any product.



215 Vineyard Court, Morgan Hill, CA 95037 | Ph: 408.778.4200 | Fax 408.778.4300 | info@markimicrowave.com

www.markimicrowave.com




DOUBLE-BALANCED MIXERS


M1-0208

Page 3

LO/RF 2.0 to 8.0 GHz IF DC to 2.0 GHz

Typical Performance (cont.)

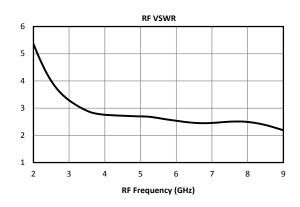

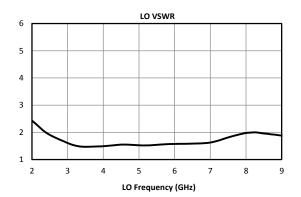

DATA SHEET NOTES:

- 1. Mixer Conversion Loss Plot IF frequency is 100 MHz.
- 2. Mixer Noise Figure typically measures within +0.5 dB of conversion loss for IF frequencies greater than 5 MHz.
- 3. Conversion Loss typically degrades less than 0.5 dB for LO drives 2 dB below the lowest and 3 dB above highest nominal LO drive levels.
- 4. Conversion Loss typically degrades less than 0.5 dB at +100°C and improves less than 0.5 dB at -55°C.
- 5. Maximum input power is +23 dBm at +25°C, derated linearly to +20 dBm at +100°C.
- 6. Specifications are subject to change without notice. Contact Marki Microwave for the most recent specifications and data sheets.
- 7. Standard configuration for A, B, and C outlines are with connectors and bottom spacer.
- 8. Catalog mixer circuits are continually improved. Configuration control requires custom mixer model numbers and specifications.

Marki Microwave reserves the right to make changes to the product(s) or information contained herein without notice. Marki Microwave makes no warranty, representation, or guarantee regarding the suitability of its products for any particular purpose, nor does Marki Microwave assume any liability whatsoever arising out of the use or application of any product.

© Marki Microwave, Inc.

215 Vineyard Court, Morgan Hill, CA 95037 | Ph: 408.778.4200 | Fax 408.778.4300 | info@markimicrowave.com

www.markimicrowave.com